



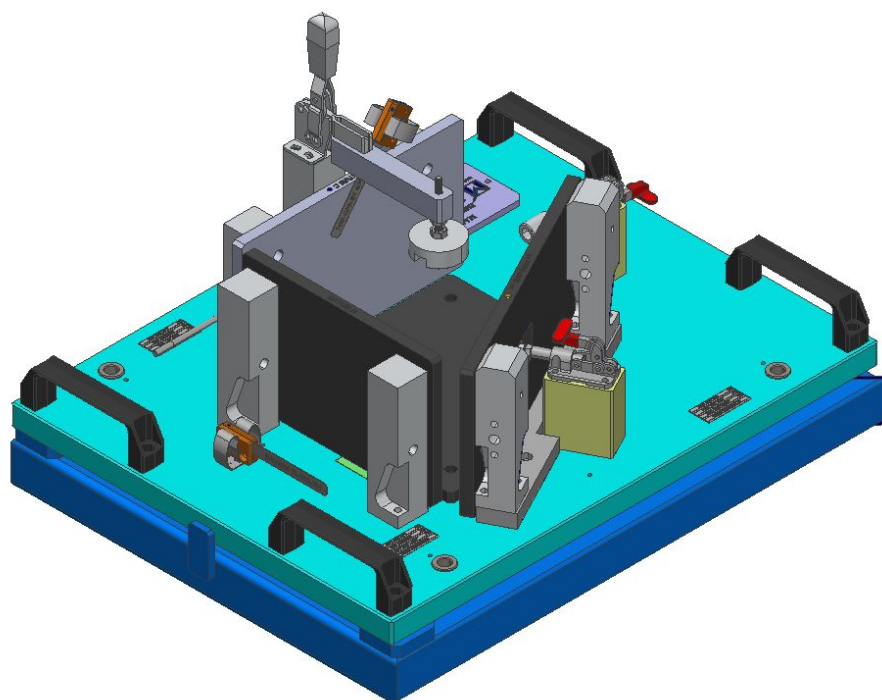

Customer: MAGOVE
Operator: GAMALIEL LUGIO
E-mail: gamaliel@mess.com.mx
Workspace: Espacio de trabajo 2
Project: CNS003 DANIEL 2025-03-28 -

Part name: CNS003
Part number: 502913-68578224 AA
Drawing : S/R
Device: MESS-BRAA-003

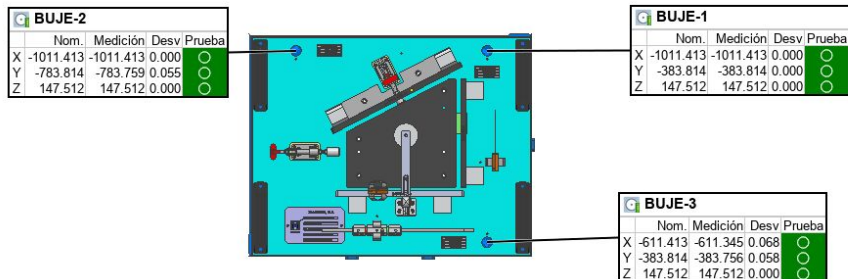

alineación

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
BUJE-1	X	-1011.413	-1011.413	±0.100	0.000	Pass
	Y	-383.814	-383.814	±0.100	0.000	Pass
	Z	147.512	147.512	±0.100	0.000	Pass
BUJE-2	X	-1011.413	-1011.413	±0.100	0.000	Pass
	Y	-783.814	-783.759	±0.100	0.055	Pass
	Z	147.512	147.512	±0.100	0.000	Pass
BUJE-3	X	-611.413	-611.345	±0.100	0.068	Pass
	Y	-383.814	-383.756	±0.100	0.058	Pass
	Z	147.512	147.512	±0.100	0.000	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGIO
 E-mail: gamaliel@mess.com.mx

Part name: CNS003
 Part number: 502913-68578224 AA
 Piece: pieza 1

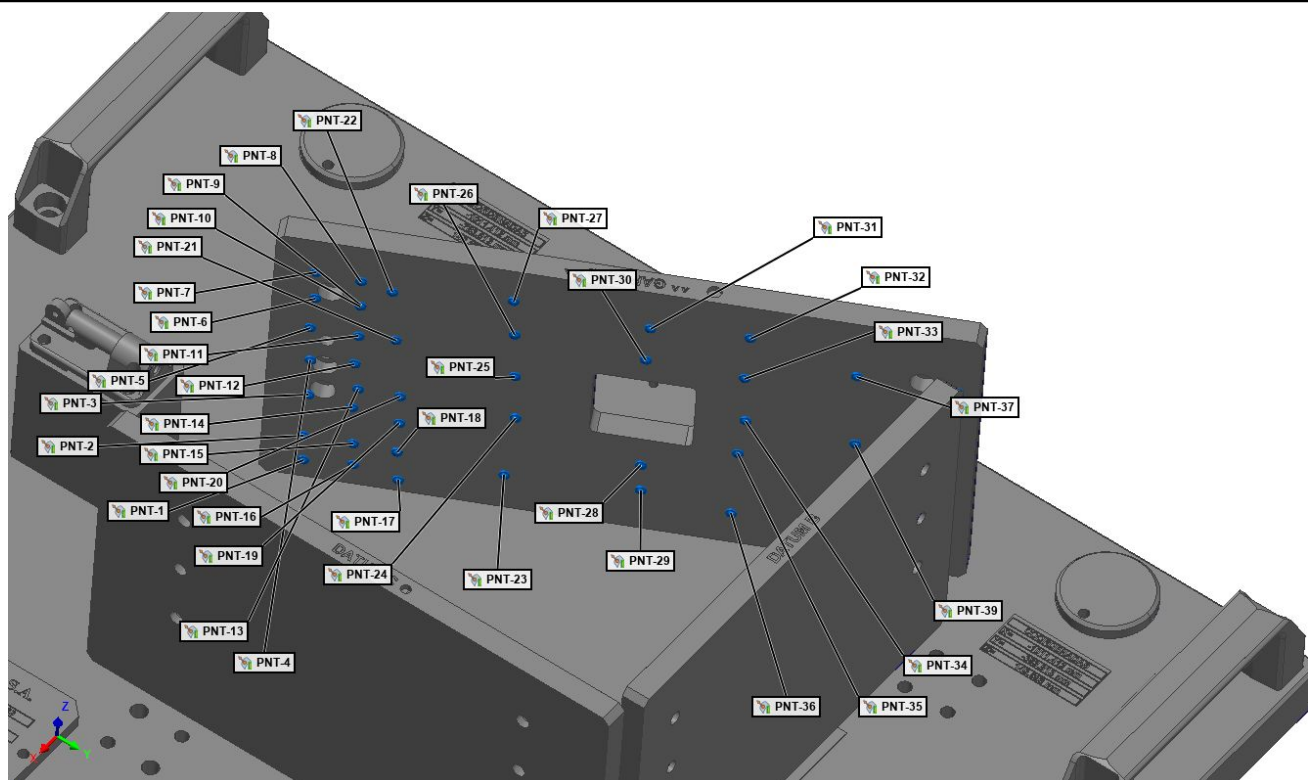


Tabla de punto de comparación

Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 PNT-1	Surface Distance		0.017	±0.150	0.017	Pass
 PNT-2	Surface Distance		0.050	±0.150	0.050	Pass
 PNT-3	Surface Distance		-0.003	±0.150	-0.003	Pass
 PNT-4	Surface Distance		0.036	±0.150	0.036	Pass
 PNT-5	Surface Distance		0.038	±0.150	0.038	Pass
 PNT-6	Surface Distance		0.016	±0.150	0.016	Pass
 PNT-7	Surface Distance		0.032	±0.150	0.032	Pass
 PNT-8	Surface Distance		0.013	±0.150	0.013	Pass
 PNT-9	Surface Distance		0.028	±0.150	0.028	Pass
 PNT-10	Surface Distance		0.014	±0.150	0.014	Pass
 PNT-11	Surface Distance		0.049	±0.150	0.049	Pass
 PNT-12	Surface Distance		0.012	±0.150	0.012	Pass
 PNT-13	Surface Distance		0.048	±0.150	0.048	Pass
 PNT-14	Surface Distance		0.019	±0.150	0.019	Pass
 PNT-15	Surface Distance		0.020	±0.150	0.020	Pass
 PNT-16	Surface Distance		0.054	±0.150	0.054	Pass
 PNT-17	Surface Distance		0.034	±0.150	0.034	Pass

Customer: MAGOVE
Operator: GAMALIEL LUGIO
E-mail: gamaliel@mess.com.mx

Part name: CNS003
Part number: 502913-68578224 AA
Piece: pieza 1

	PNT-18	Surface Distance	0.008	±0.150	0.008	Pass
	PNT-19	Surface Distance	0.020	±0.150	0.020	Pass
	PNT-20	Surface Distance	0.036	±0.150	0.036	Pass
	PNT-21	Surface Distance	0.012	±0.150	0.012	Pass
	PNT-22	Surface Distance	-0.005	±0.150	-0.005	Pass
	PNT-23	Surface Distance	0.051	±0.150	0.051	Pass
	PNT-24	Surface Distance	0.020	±0.150	0.020	Pass
	PNT-25	Surface Distance	0.036	±0.150	0.036	Pass
	PNT-26	Surface Distance	0.039	±0.150	0.039	Pass
	PNT-27	Surface Distance	0.031	±0.150	0.031	Pass
	PNT-28	Surface Distance	0.062	±0.150	0.062	Pass
	PNT-29	Surface Distance	0.036	±0.150	0.036	Pass
	PNT-30	Surface Distance	0.046	±0.150	0.046	Pass
	PNT-31	Surface Distance	0.022	±0.150	0.022	Pass
	PNT-32	Surface Distance	0.005	±0.150	0.005	Pass
	PNT-33	Surface Distance	0.022	±0.150	0.022	Pass
	PNT-34	Surface Distance	0.022	±0.150	0.022	Pass
	PNT-35	Surface Distance	0.018	±0.150	0.018	Pass
	PNT-36	Surface Distance	-0.039	±0.150	-0.039	Pass
	PNT-37	Surface Distance	-0.046	±0.150	-0.046	Pass
	PNT-38	Surface Distance	-0.024	±0.150	-0.024	Pass
	PNT-39	Surface Distance	-0.050	±0.150	-0.050	Pass
	PNT-40	Surface Distance	-0.046	±0.150	-0.046	Pass
	PNT-41	Surface Distance	-0.015	±0.150	-0.015	Pass
	PNT-42	Surface Distance	-0.035	±0.150	-0.035	Pass
	PNT-43	Surface Distance	-0.034	±0.150	-0.034	Pass
	PNT-44	Surface Distance	-0.048	±0.150	-0.048	Pass
	PNT-45	Surface Distance	-0.034	±0.150	-0.034	Pass

Customer: MAGOVE
Operator: GAMALIEL LUGIO
E-mail: gamaliel@mess.com.mx

Part name: CNS003
Part number: 502913-68578224 AA
Piece: pieza 1