


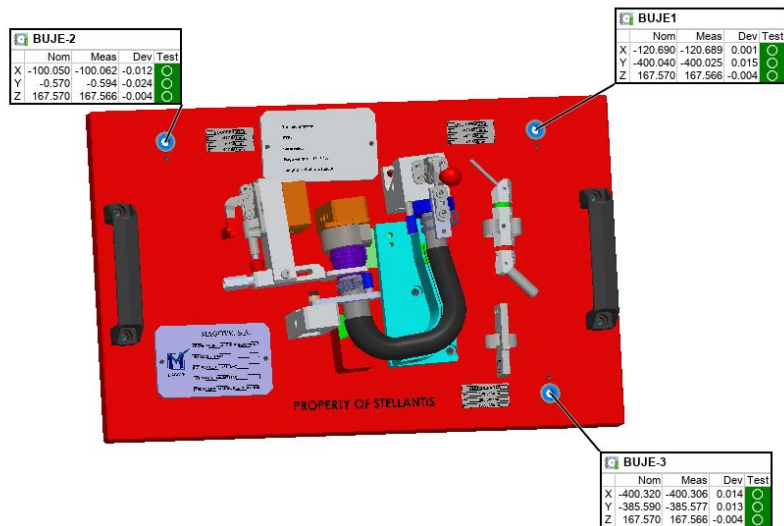


ALINEACION

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
BUJE1	X	-120.69	-120.69	±0.10	0.00	Pass
	Y	-400.04	-400.02	±0.10	0.02	Pass
	Z	167.57	167.57	±0.10	0.00	Pass
BUJE-2	X	-100.05	-100.06	±0.10	-0.01	Pass
	Y	-0.57	-0.59	±0.10	-0.02	Pass
	Z	167.57	167.57	±0.10	0.00	Pass
BUJE-3	X	-400.32	-400.31	±0.10	0.01	Pass
	Y	-385.59	-385.58	±0.10	0.01	Pass
	Z	167.57	167.57	±0.10	0.00	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1

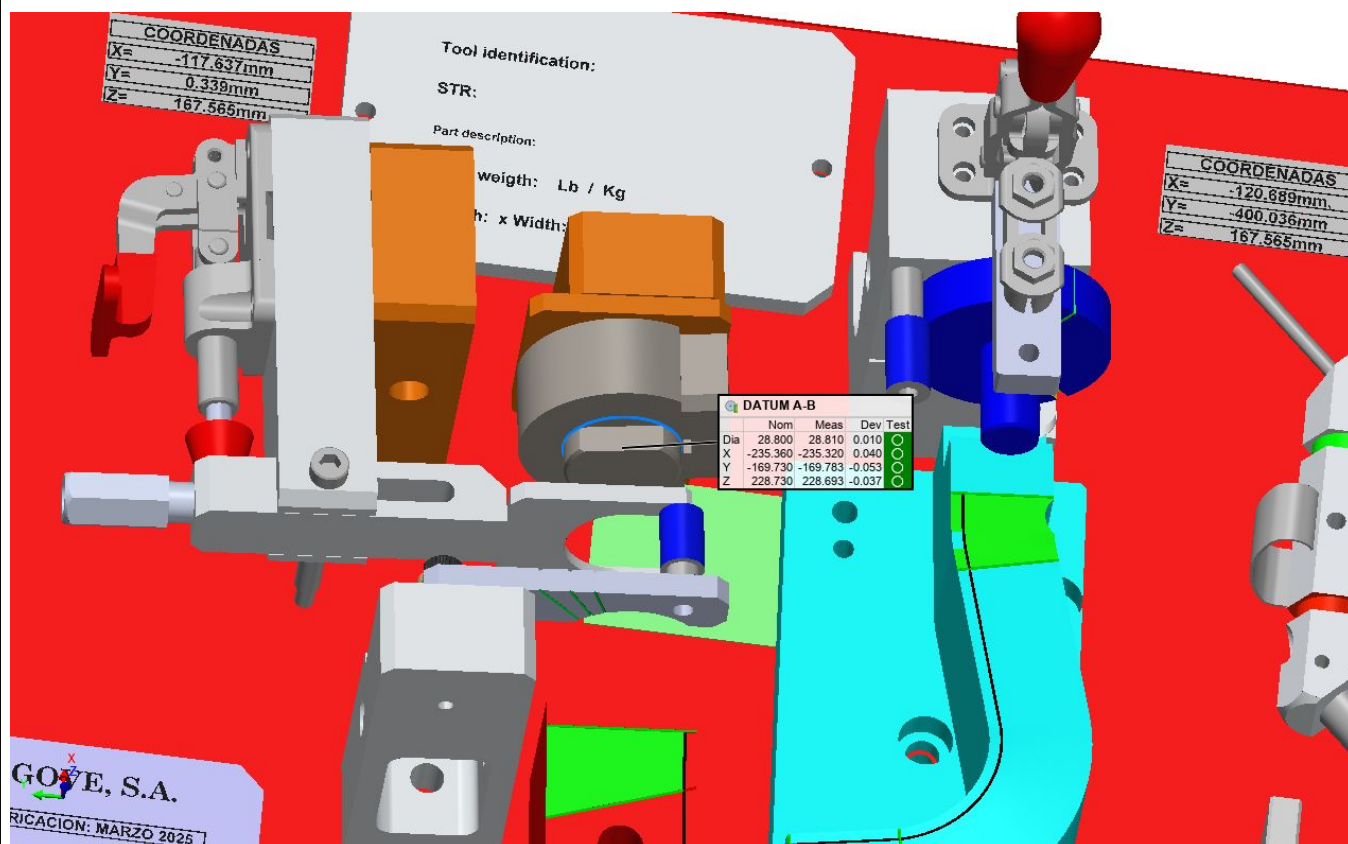

DATUM A-B

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
● DATUM A-B	Diameter	28.800	28.810	+0.020/0.000	0.010	Pass
	X	-235.360	-235.320	±0.050	0.040	Pass
	Y	-169.730	-169.783	±0.050	-0.053	Pass
	Z	228.730	228.693	±0.050	-0.037	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1



NET

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DIST-1	3D Distance	0.000	0.048	±0.100	0.048	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1




INSERCCION

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DIST-11	3D Distance	7.000	7.005	±0.150	0.005	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1

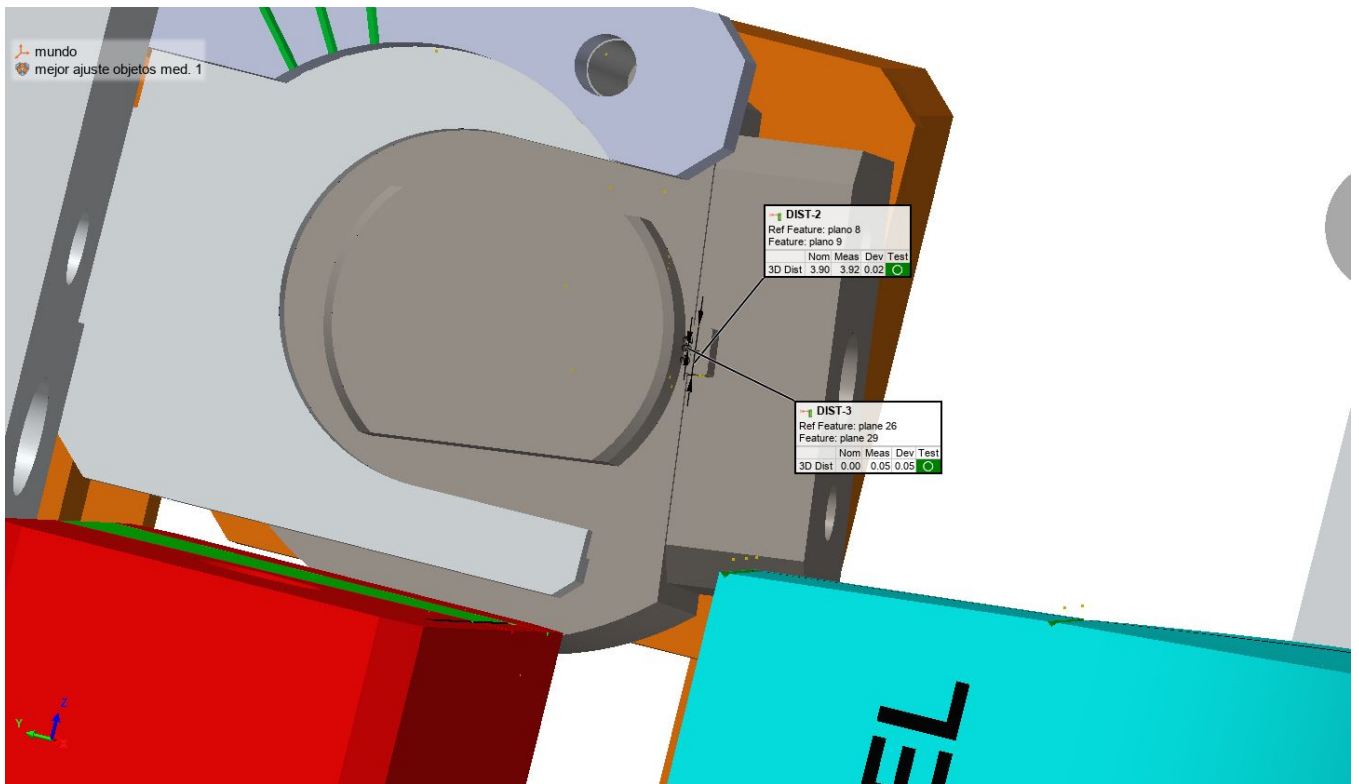


ANTIGIRO A-B

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
DIST-2	3D Distance	3.90	3.92	+0.02/0.00	0.02	Pass
DIST-3	3D Distance	0.00	0.05	±0.05	0.05	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1

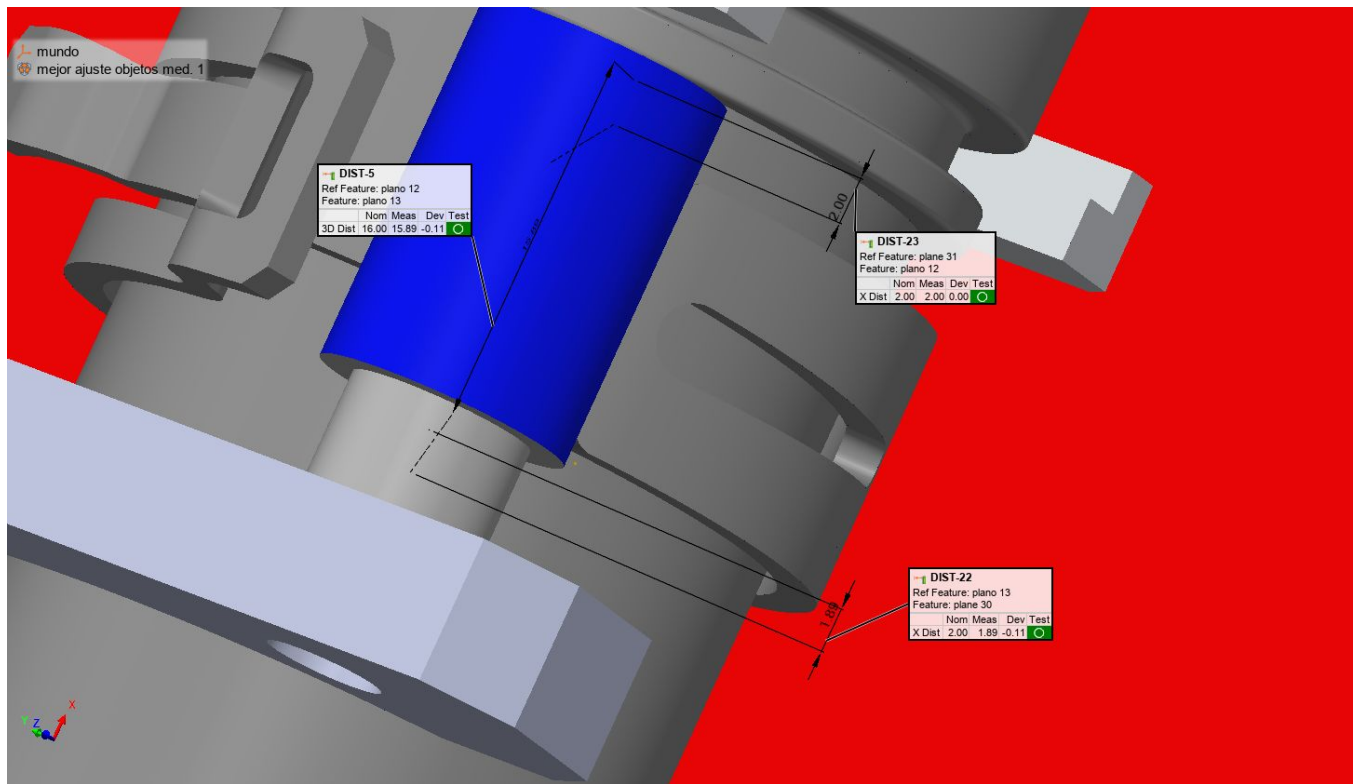

CLAMP

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DIST-5	3D Distance	16.00	15.89	±0.12	-0.11	Pass
 DIST-22	X Distance	2.00	1.89	±0.20	-0.11	Pass
 DIST-23	X Distance	2.00	2.00	±0.20	0.00	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1

ORIENTACION ANGULAR C-D

115° NOMINAL

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
115° NOMINAL	3D Angle 2	115.00	114.98	±1.00	-0.02	Pass

105° TOL MENOR


Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
105° TOL MENOR	3D Angle 2	105.00	104.98	±1.00	-0.02	Pass

125 TOL MAYOR


Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
125° TOL MAYOR	3D Angle 2	125.00	124.98	±1.00	-0.02	Pass

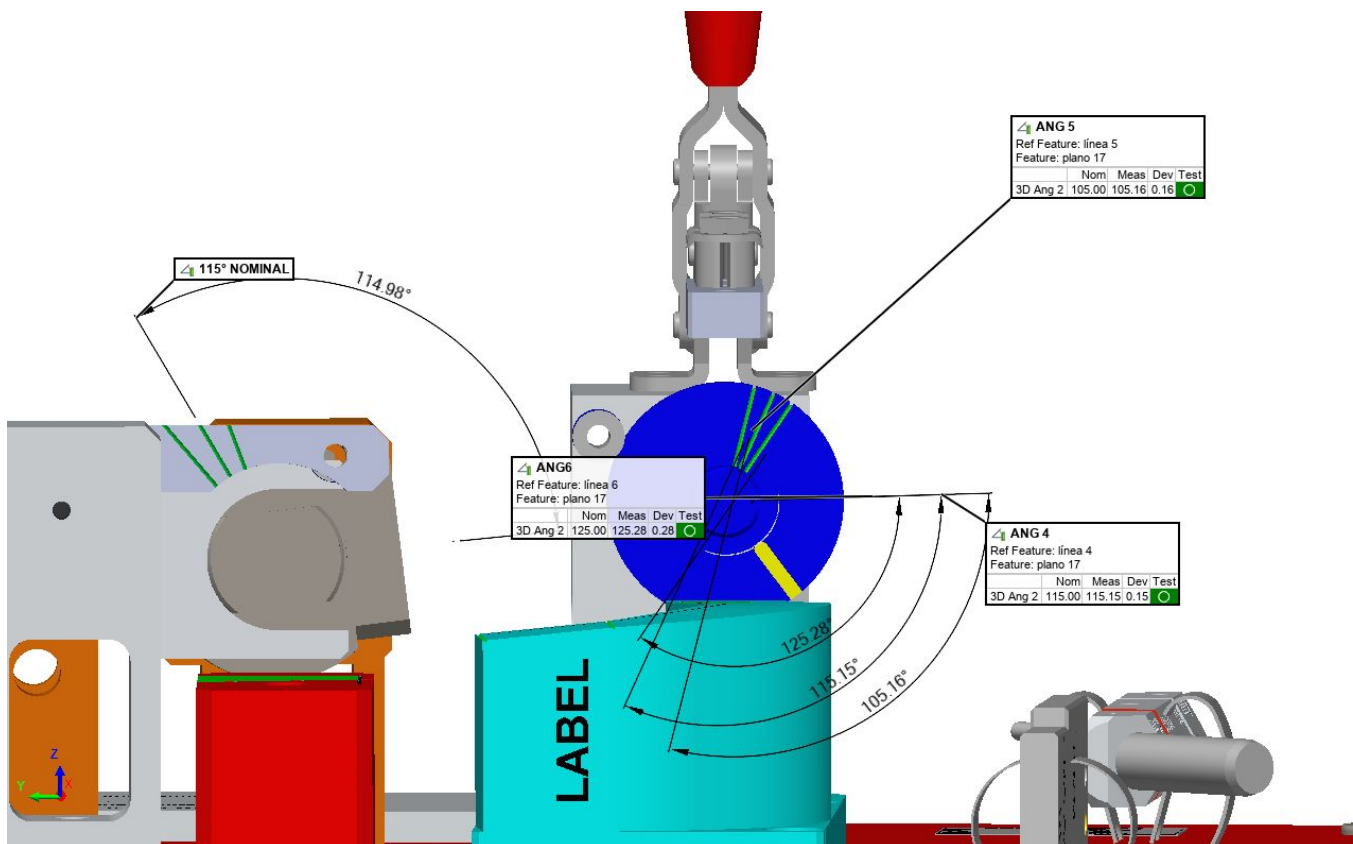

Customer: MAGOVE
Operator: GAMALIEL LUGO
E-mail: gamaliel@mess.com.mx

Part name: TRI021
Part number: 68646745AC
Piece: pieza 1

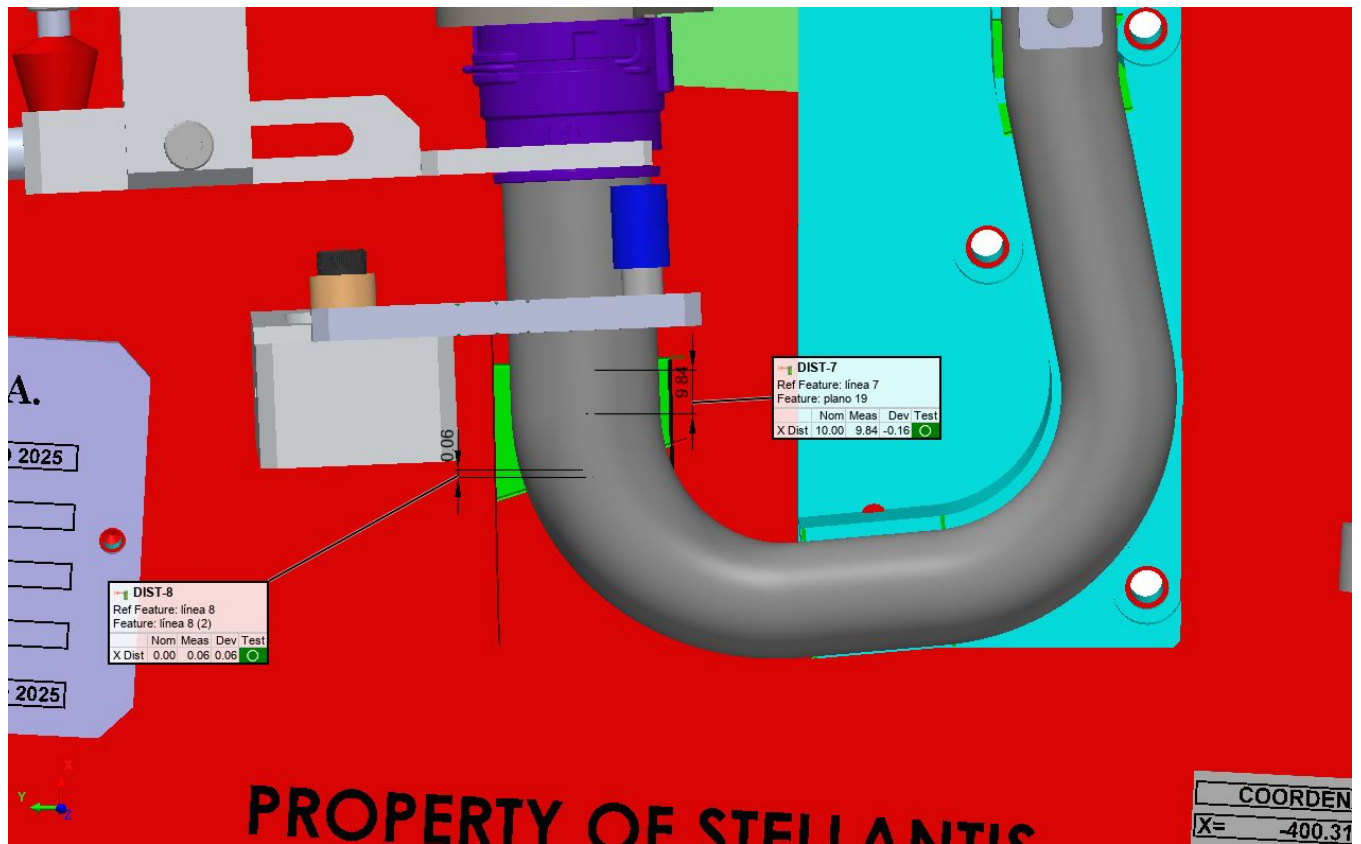


POSICION MANGA SL1

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
DIST-7	X Distance	10.00	9.84	±0.20	-0.16	Pass
DIST-8	X Distance	0.00	0.06	±0.20	0.06	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1

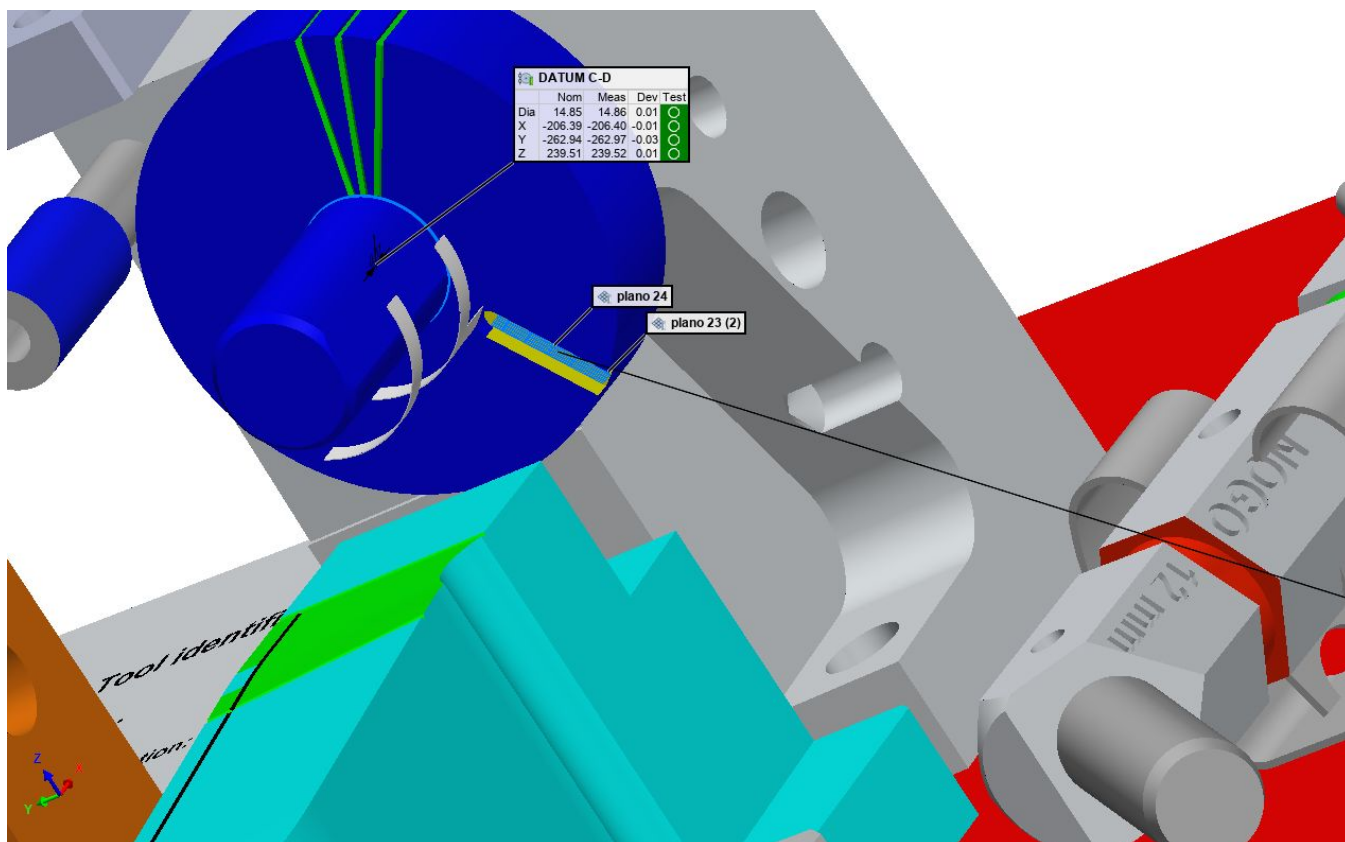

DATUM C-D

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DATUM C-D	Diameter	14.85	14.86	+0.02/0.00	0.01	Pass
	X	-206.39	-206.40	±0.05	-0.01	Pass
	Y	-262.94	-262.97	±0.05	-0.03	Pass
	Z	239.51	239.52	±0.05	0.01	Pass

NET

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DIST-9	3D Distance	0.00	0.01	±0.10	0.01	Pass


PAINT MARK

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DIST-10	3D Distance	0.00	0.00	±0.05	0.00	Pass

Customer: MAGOVE
Operator: GAMALIEL LUGO
E-mail: gamaliel@mess.com.mx

Part name: TRI021
Part number: 68646745AC
Piece: pieza 1

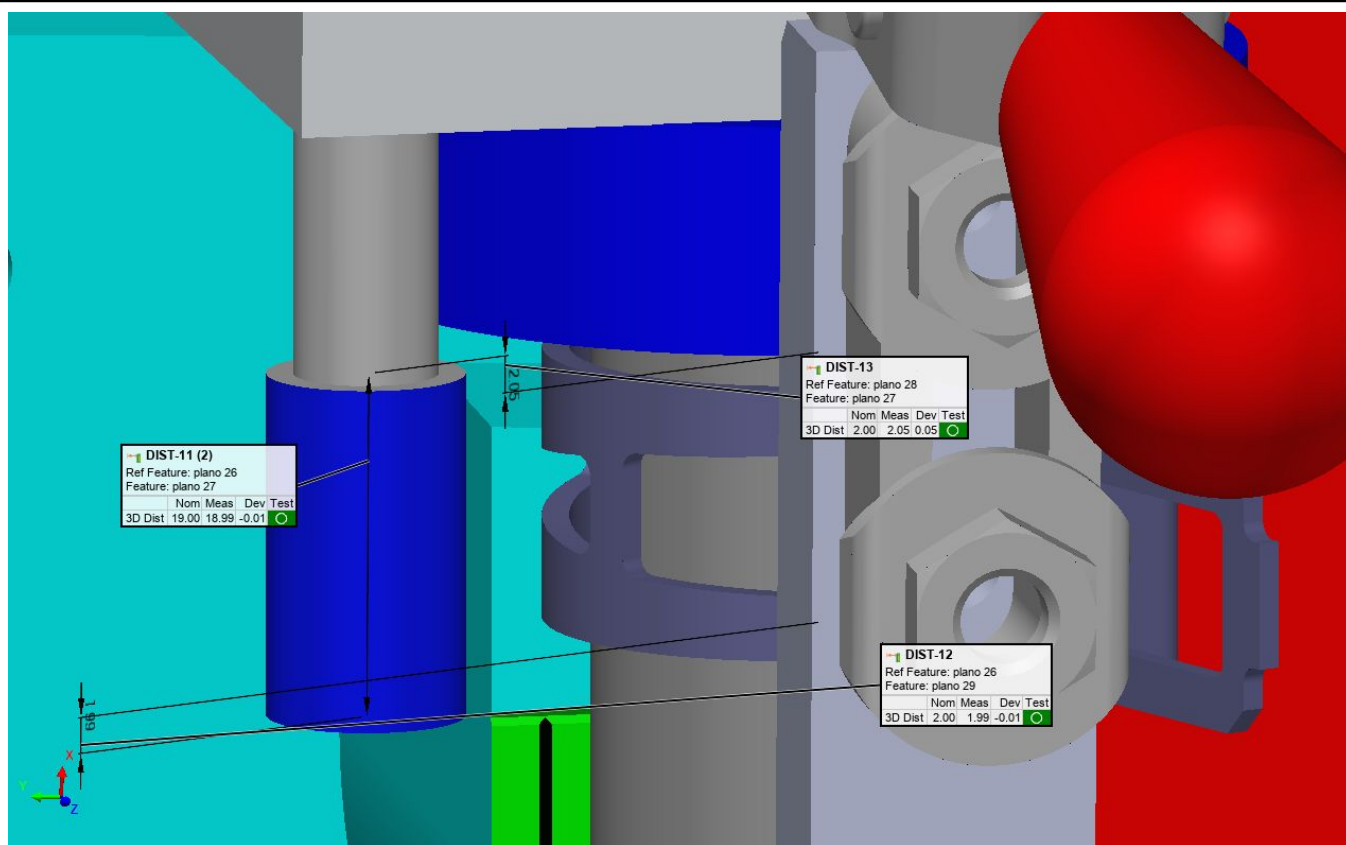


CLAMP C-D

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DIST-11 (2)	3D Distance	19.00	18.99	±0.12	-0.01	Pass
 DIST-12	3D Distance	2.00	1.99	±0.20	-0.01	Pass
 DIST-13	3D Distance	2.00	2.05	±0.20	0.05	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1

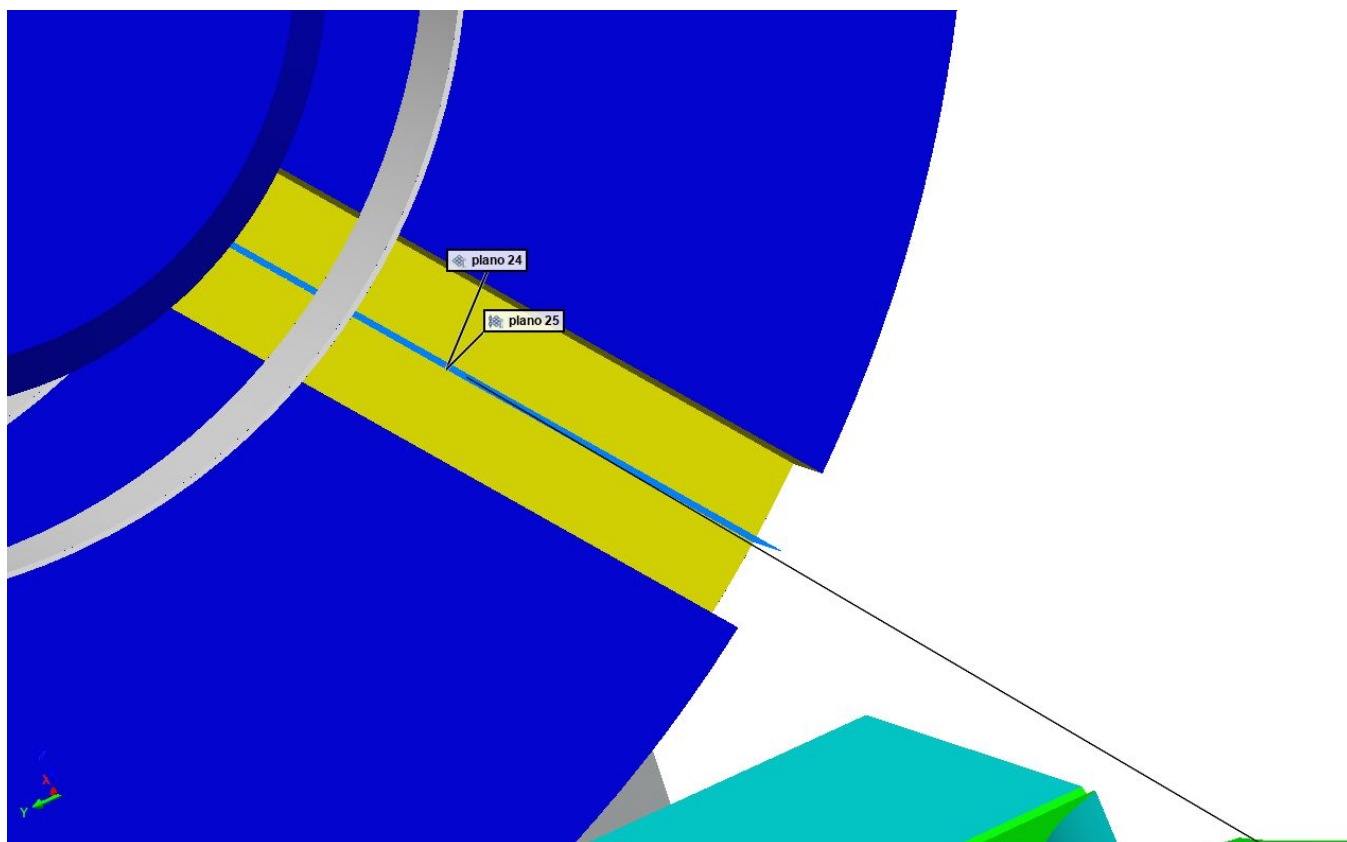


PAINT MARK

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DIST-10	3D Distance	0.00	0.00	±0.05	0.00	Pass

Customer: MAGOVE
Operator: GAMALIEL LUGO
E-mail: gamaliel@mess.com.mx

Part name: TRI021
Part number: 68646745AC
Piece: pieza 1

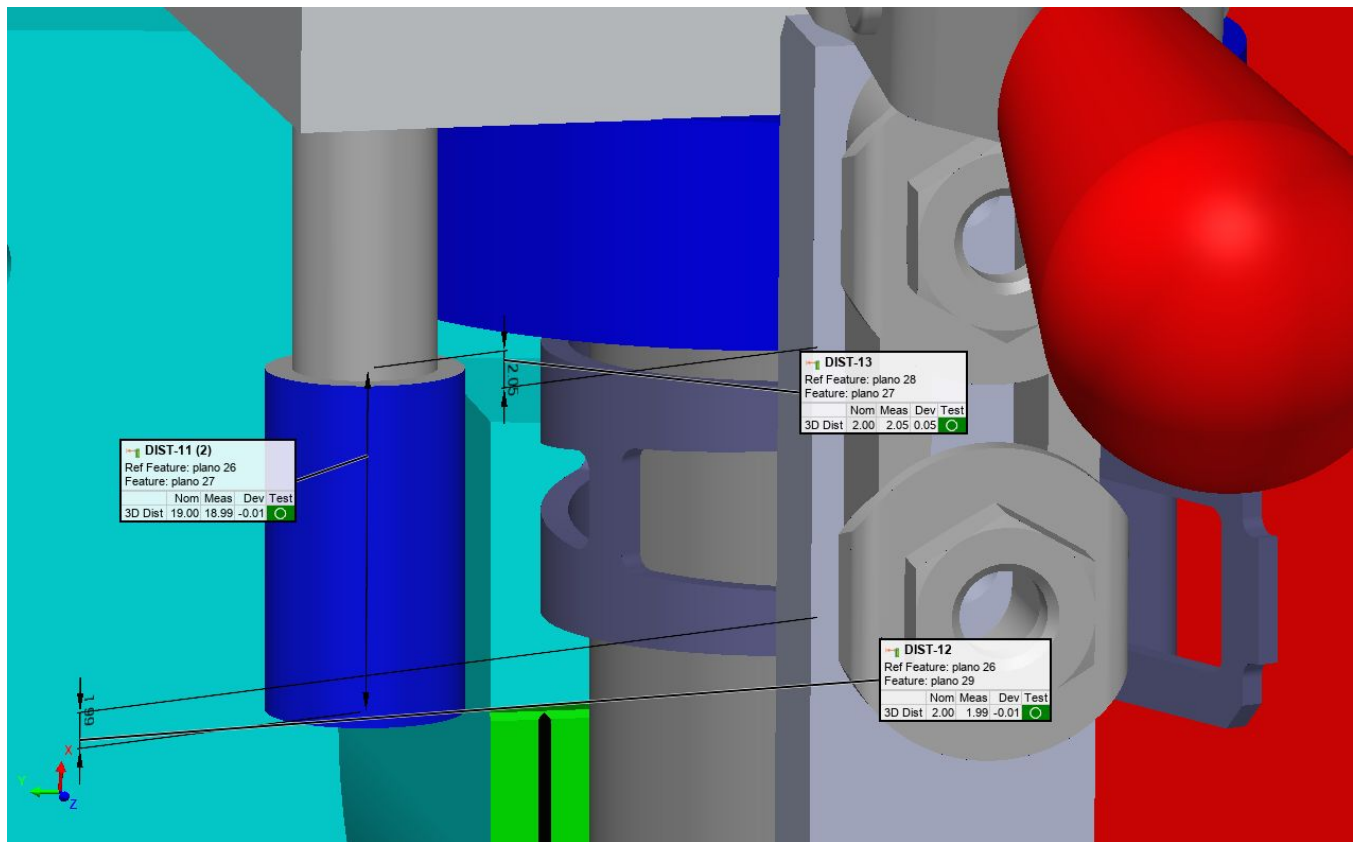


CLAMP C-D

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
DIST-11 (2)	3D Distance	19.00	18.99	±0.12	-0.01	Pass
DIST-12	3D Distance	2.00	1.99	±0.20	-0.01	Pass
DIST-13	3D Distance	2.00	2.05	±0.20	0.05	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1

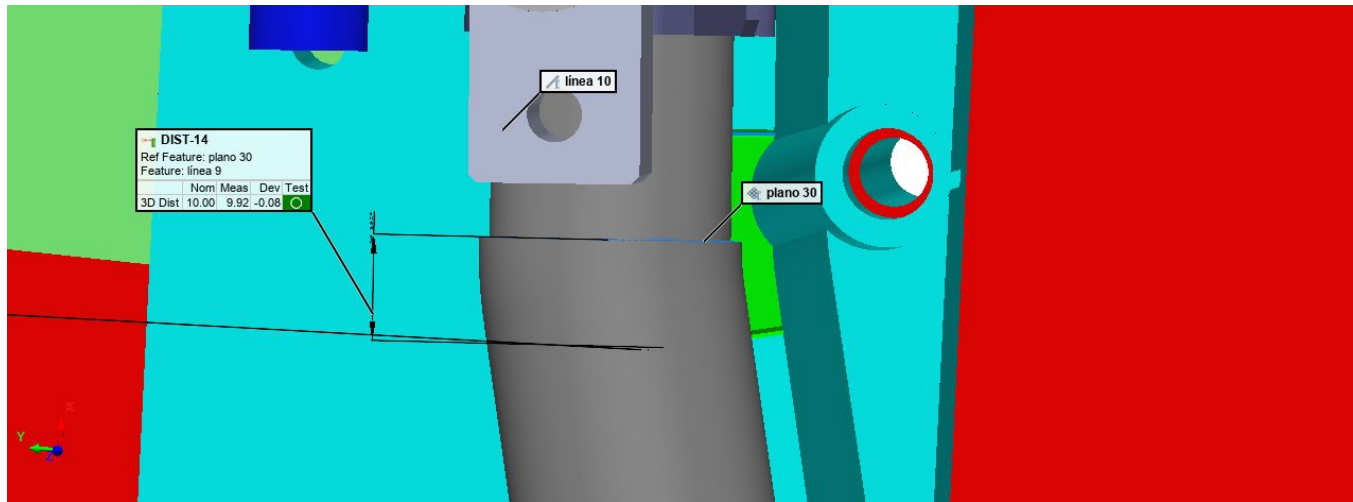


MANGAS PUNTO HA4

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
↔ DIST-14	3D Distance	10.00	9.92	±0.20	-0.08	Pass
↔ DIST-15	X Distance	0.00	0.00	±0.20	0.00	Pass

Customer: MAGOVE
Operator: GAMALIEL LUGO
E-mail: gamaliel@mess.com.mx

Part name: TRI021
Part number: 68646745AC
Piece: pieza 1

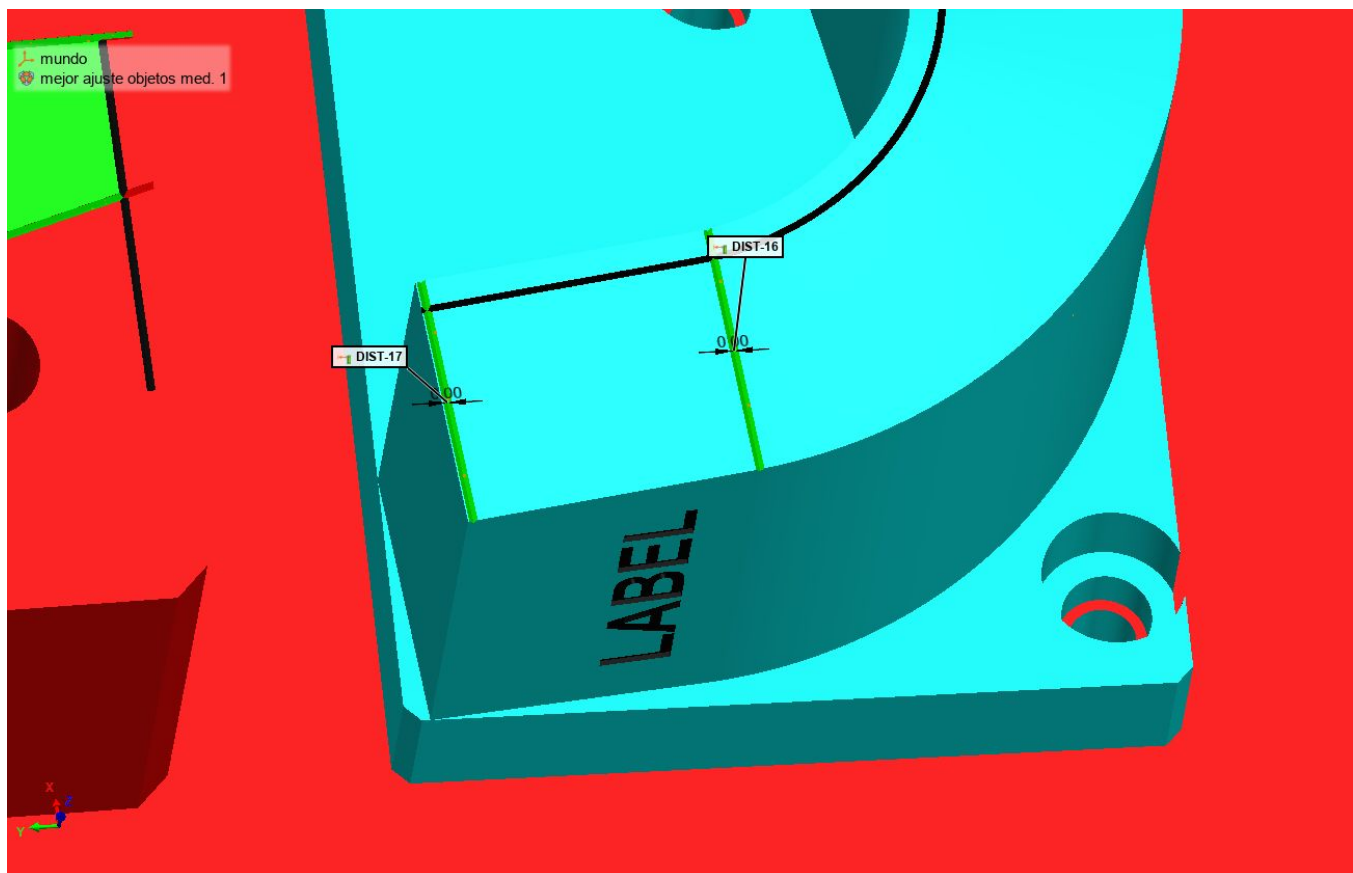


POSICION DE ETIQUETA

Length Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 DIST-16	3D Distance	0.00	0.00	±0.20	0.00	Pass
 DIST-17	3D Distance	0.00	0.00	±0.20	0.00	Pass

Customer: MAGOVE
 Operator: GAMALIEL LUGO
 E-mail: gamaliel@mess.com.mx

Part name: TRI021
 Part number: 68646745AC
 Piece: pieza 1

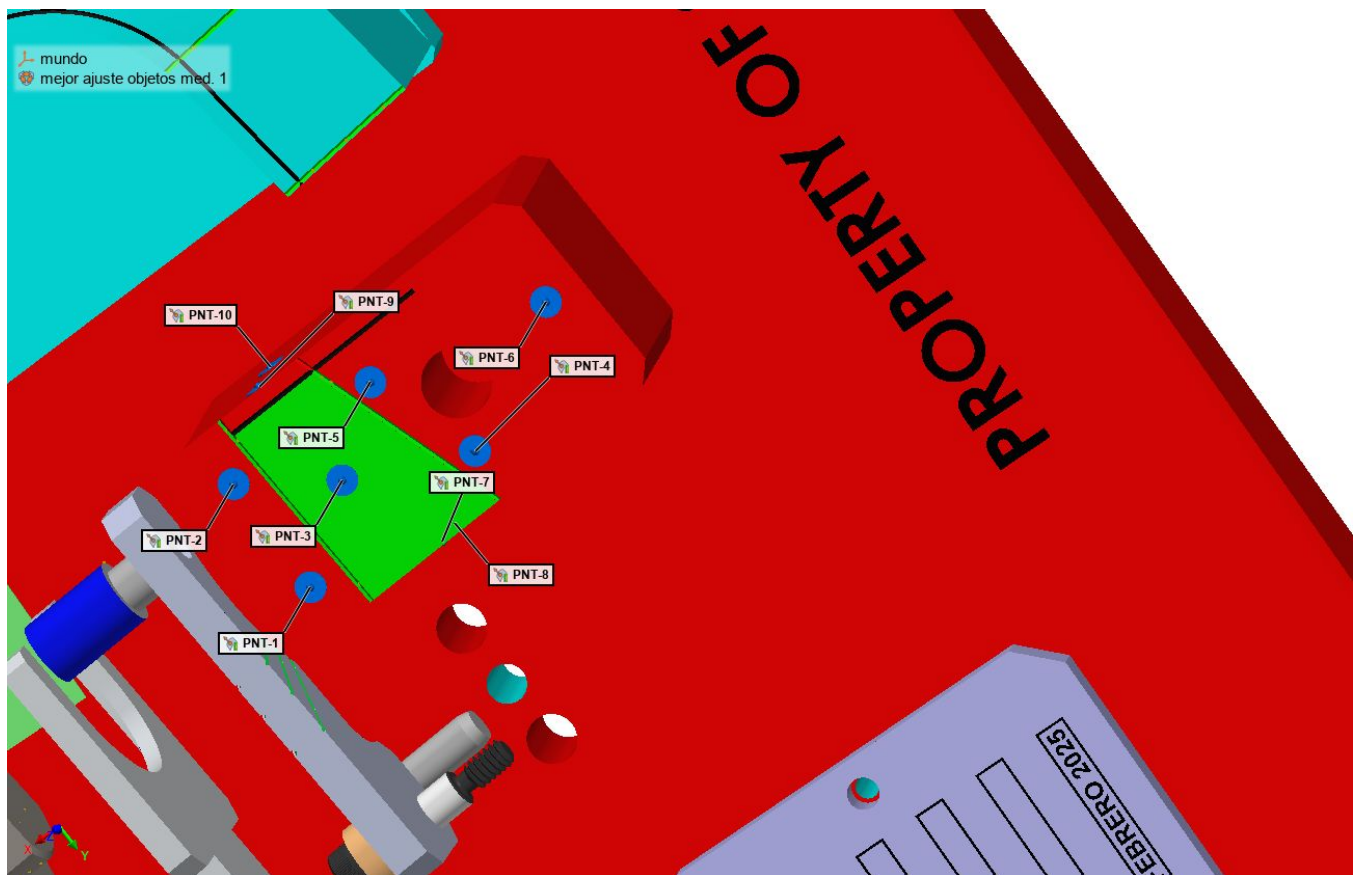


PERFIL MOLDE 1

Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
 PNT-1	Surface Distance		-0.17	±0.20	-0.17	Pass
 PNT-2	Surface Distance		-0.16	±0.20	-0.16	Pass
 PNT-3	Surface Distance		-0.15	±0.20	-0.15	Pass
 PNT-4	Surface Distance		-0.18	±0.20	-0.18	Pass
 PNT-5	Surface Distance		-0.16	±0.20	-0.16	Pass
 PNT-6	Surface Distance		-0.17	±0.20	-0.17	Pass
 PNT-7	Surface Distance		-0.09	±0.20	-0.09	Pass
 PNT-8	Surface Distance		-0.11	±0.20	-0.11	Pass
 PNT-9	Surface Distance		-0.04	±0.20	-0.04	Pass
 PNT-10	Surface Distance		-0.02	±0.20	-0.02	Pass

Customer: MAGOVE
Operator: GAMALIEL LUGO
E-mail: gamaliel@mess.com.mx

Part name: TRI021
Part number: 68646745AC
Piece: pieza 1

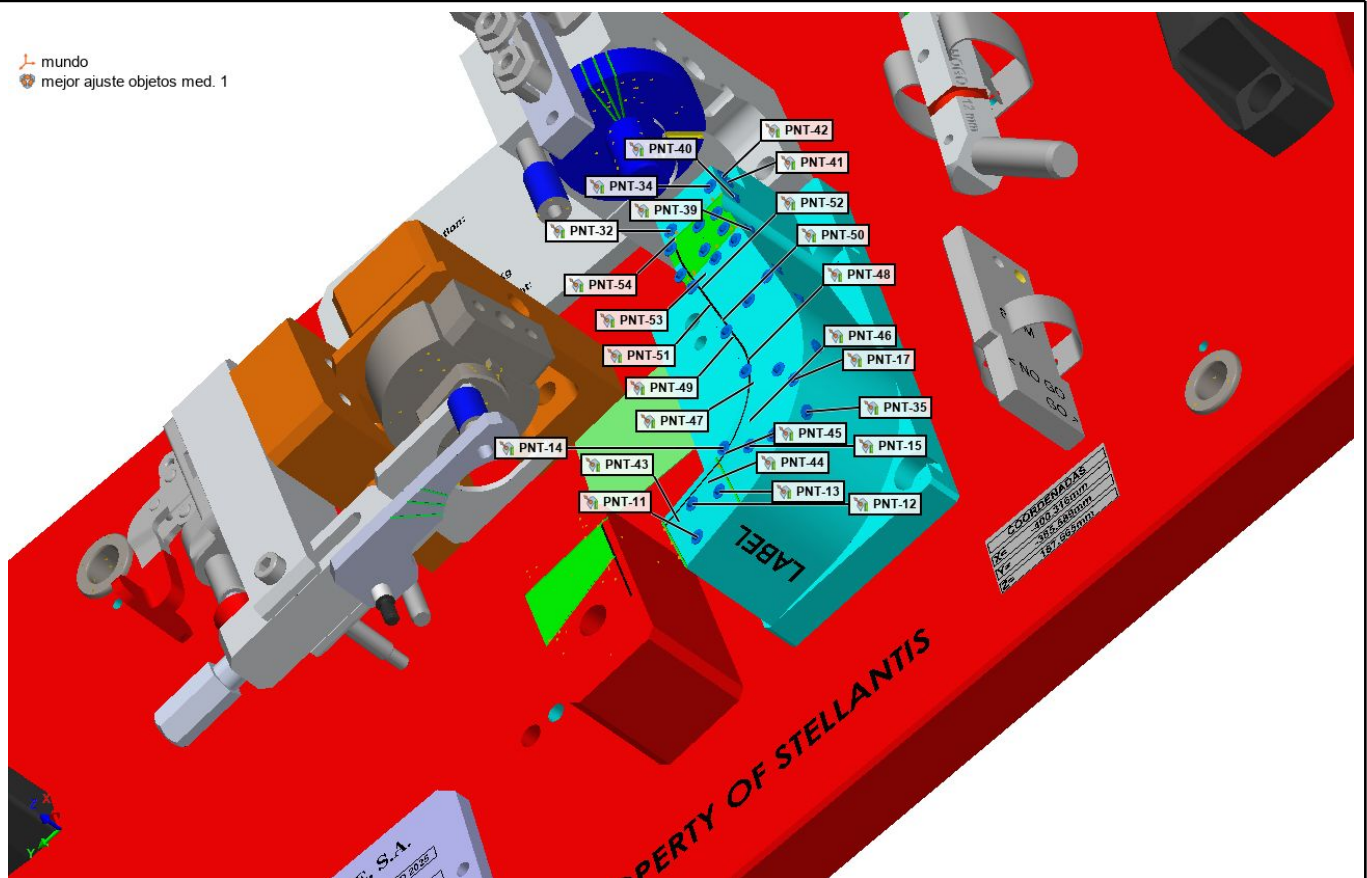

PERFIL DE MOLDE 2

Units Millimeters

Name	Control	Nom	Meas	Tol	Dev	Test
PNT-11	Surface Distance		-0.14	±0.20	-0.14	Pass
PNT-12	Surface Distance		-0.13	±0.20	-0.13	Pass
PNT-13	Surface Distance		-0.12	±0.20	-0.12	Pass
PNT-14	Surface Distance		-0.12	±0.20	-0.12	Pass
PNT-15	Surface Distance		-0.11	±0.20	-0.11	Pass
PNT-16	Surface Distance		-0.11	±0.20	-0.11	Pass
PNT-17	Surface Distance		-0.11	±0.20	-0.11	Pass
PNT-18	Surface Distance		-0.11	±0.20	-0.11	Pass
PNT-19	Surface Distance		-0.11	±0.20	-0.11	Pass
PNT-20	Surface Distance		-0.13	±0.20	-0.13	Pass
PNT-21	Surface Distance		-0.12	±0.20	-0.12	Pass
PNT-22	Surface Distance		-0.11	±0.20	-0.11	Pass
PNT-23	Surface Distance		-0.13	±0.20	-0.13	Pass
PNT-24	Surface Distance		-0.12	±0.20	-0.12	Pass
PNT-25	Surface Distance		-0.11	±0.20	-0.11	Pass
PNT-26	Surface Distance		-0.15	±0.20	-0.15	Pass
PNT-27	Surface Distance		-0.12	±0.20	-0.12	Pass

Customer: MAGOVE
Operator: GAMALIEL LUGO
E-mail: gamaliel@mess.com.mx

Part name: TRI021
Part number: 68646745AC
Piece: pieza 1

	PNT-28	Surface Distance	-0.12	±0.20	-0.12	Pass
	PNT-29	Surface Distance	-0.12	±0.20	-0.12	Pass
	PNT-30	Surface Distance	-0.11	±0.20	-0.11	Pass
	PNT-31	Surface Distance	-0.11	±0.20	-0.11	Pass
	PNT-32	Surface Distance	-0.11	±0.20	-0.11	Pass
	PNT-33	Surface Distance	-0.10	±0.20	-0.10	Pass
	PNT-34	Surface Distance	-0.10	±0.20	-0.10	Pass
	PNT-35	Surface Distance	-0.05	±0.20	-0.05	Pass
	PNT-36	Surface Distance	-0.09	±0.20	-0.09	Pass
	PNT-37	Surface Distance	-0.08	±0.20	-0.08	Pass
	PNT-38	Surface Distance	-0.09	±0.20	-0.09	Pass
	PNT-39	Surface Distance	-0.10	±0.20	-0.10	Pass
	PNT-40	Surface Distance	-0.09	±0.20	-0.09	Pass
	PNT-41	Surface Distance	-0.09	±0.20	-0.09	Pass
	PNT-42	Surface Distance	-0.10	±0.20	-0.10	Pass
	PNT-43	Surface Distance	-0.05	±0.20	-0.05	Pass
	PNT-44	Surface Distance	-0.05	±0.20	-0.05	Pass
	PNT-45	Surface Distance	-0.06	±0.20	-0.06	Pass
	PNT-46	Surface Distance	-0.06	±0.20	-0.06	Pass
	PNT-47	Surface Distance	-0.04	±0.20	-0.04	Pass
	PNT-48	Surface Distance	-0.03	±0.20	-0.03	Pass
	PNT-49	Surface Distance	-0.03	±0.20	-0.03	Pass
	PNT-50	Surface Distance	-0.03	±0.20	-0.03	Pass
	PNT-51	Surface Distance	-0.03	±0.20	-0.03	Pass
	PNT-52	Surface Distance	-0.07	±0.20	-0.07	Pass
	PNT-53	Surface Distance	-0.07	±0.20	-0.07	Pass
	PNT-54	Surface Distance	-0.06	±0.20	-0.06	Pass

Customer: MAGOVE
Operator: GAMALIEL LUGO
E-mail: gamaliel@mess.com.mx

Part name: TRI021
Part number: 68646745AC
Piece: pieza 1